

# Consumer Product Service Manager of Technical Support TECH TIP

TT HCD number 16

MODEL:

ATARI 310 Disk Drive

DATE: June 6, 1983

# SUBJECT:

Incorrect 12 Voltage Regulator

## DESCRIPTION:

All 810 Disk Drives manufactured during 1982 work week 51, should be checked for the proper 12V Regulator on the Power Supply PCB.

## PROBLEM:

Some 0.5 amp Regulators became mixed-in with the 1.0 amp Regulators during production. The Regulator's specification calls for a 1.0 amp.

# SOLUTION:

A Waster Cammanagement Comm

When performing repairs on the 810, visually inspect the voltage regulator. Make certain that it does not bear the number 78M12. If a 78M12 is found, replace it with a 7812 (Atari Part Number - C014712).

### TROUBLESHOOTING:

This change does not effect the troubleshooting procedures outlined in the Atari 810 Disk Drive Field Service Manual (FD100003).

#### DIFFICULTY REPORTING:

If you have questions or need further assistance, call the Atari Techline Specialist:

Inside California (800) 672-1466

Outside California (800) 538-1535